

BELZONA POSITIVE GRIP SYSTEM PROVIDES SAFETY TO WORKERS

CUSTOMER

Tennessee, USA

APPLICATION DATE

September 2016

APPLICATION SITUATION

A manufacturer's movable step ladders needed a permanent non-slip added to keep workers safe.

PROBLEM

Steel steps used around manufacturing equipment in an oily environment were slippery and hazardous to workers safety. Previous applications of non-slip tape were short lived and not effective.

PRODUCTS

Belzona 5811 (Immersion Grade)

Belzona 9211 (Supergrip Aggregate)

SUBSTRATE

Carbon Steel

APPLICATION METHOD


Application was carried out using Belzona Know-How System Leaflet FPA-8. Steps were cleaned and roughened with an angle grinder. Edges were taped off to create clean lines. First, Belzona 5811 was applied at 20 mils thickness, then Belzona 9211 was added to the point of rejection.

BELZONA FACTS


One of the alternative solutions was to use a non-slip tape which had already been proven to be ineffective. When the application is completed on remaining steps the cost of the Belzona application will be approximately double per square foot but will last approximately forty times longer, paying for itself in the first two years and saving the customer far more over time.

PICTURES

1. Steps prepared for application
2. Application of Belzona 5811 in progress
3. Application of Belzona 5811 and 9211 completed
4. Application revisited two months later, already outperforming the non-slip tape

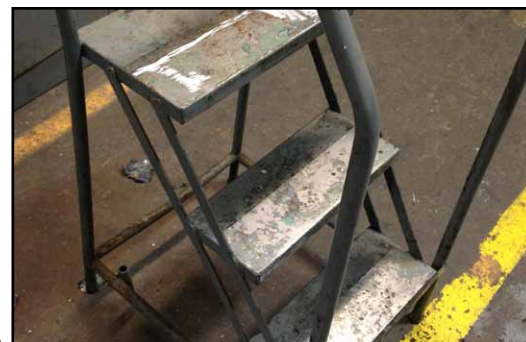

1.

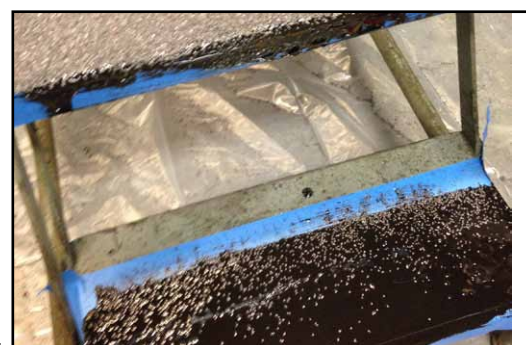

2.



3.



4.

For more examples of *Belzona Know-How In Action*, please visit <http://khia.belzona.com>



ISO 9001:2008
Q 09335
ISO 14001:2004
EMS 509612

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

UK • USA • Canada • Thailand
www.belzona.com


BELZONA
Repair • Protect • Improve