

BELZONA 1818 SCREENED FOR SUCCESS

CUSTOMER

Dallas-Fort Worth Metroplex, Texas, USA

APPLICATION DATE

April, 2021

APPLICATION SITUATION

A major paper recycling plant that operates almost full time and only stops production for twelve hours, once a month to perform routine maintenance. To avoid erosion and abrasion along in an attempt to prolong the life of their Turbo Separators, they are lined with two-inch-thick ceramic tiles. This type of disc screen is designed specifically for coarse screening in pulp strainers with high trash and flake material, such as recycled paper, which is what the mill uses as a feedstock to make 100% recycled kraft paper and packaging.

PROBLEM

During normal operation, a large metal foreign object went through the turbo separator. The internal lining was severely damaged in a 4ft x 3ft area. The process of replacing tiles is a time-consuming operation and the mill did not have the time available to make their typical repairs. In order to operate the equipment, they needed a repair to be completed in less than twelve hours from shut down to start up.

PRODUCTS

Belzona 1818

SUBSTRATE

Steel and Ceramic Tiles

APPLICATION METHOD

The application was completed using a modified version of SHM-07. Loose and damaged tiles were removed. The steel substrate and ceramic tiles were abrasive blasted to create a suitable profile. Belzona 1818 was used to rebuild the area of lost tiles and provide an abrasion-resistant coating.

BELZONA FACTS

The customer had confidence in the Belzona 1800 series, as seven years ago they used Belzona 1812 to grout and make small repairs to the same equipment. These repairs were still in excellent condition. A total of 112 Kg was used to rebuild the area. The application from the start to completion was completed in less than 7 hours and the equipment was able to be restarted with no delays.

PICTURES


1. External view of Turbo Separator in the mill
2. Internal view of Turbo Separator showing damaged/lost tiles
3. Application of 1818 commencing
4. Additional 1818 being applied



1.



2.

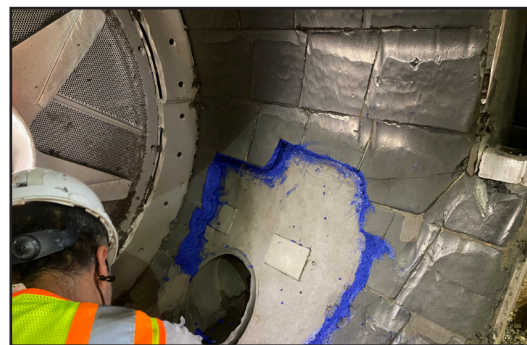

3.



4.

For more examples of *Belzona Know-How In Action*, please visit <http://khia.belzona.com>

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com

Copyright © Belzona International Limited 2021


BELZONA[®]
Repair • Protect • Improve