

BELZONA REPAIRS AIR HANDLING EQUIPMENT

ID: 5322


Industry: Heating, Ventilation & Air Conditioning
Application: MPT-Mechanical Power Transmission

Customer Location: Missouri, USA
Application Date: July 2006

Substrate: Steel
Products: * Belzona 1111 (Super Metal) ,
* Belzona 9411 (Release Agent) ,

Problem

One of the bearings on this office building's air handler system failed and severely gouged into the fan's shaft. The cooling system was nearly crippled with a triple digit, Midwest July heat.

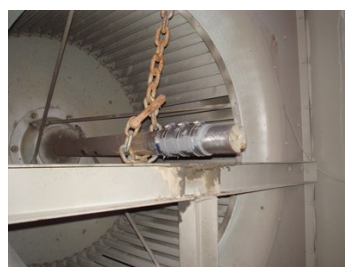

Photograph Descriptions

- * Air handler fan threw a bearing in the early a.m.; building without conditioned air for over 12 hours. ,
- * Customer secured the shaft for early a.m. repair. ,
- * Belzona repair completed before 6:00 a.m. ,
- * Completed application of shaft and ready to return to service that morning. ,

Application Situation

Bearing seized for air handling equipment.

Application Method

The shaft was supported and the pillow block was removed, exposing the damaged area. A suitable former was treated with Belzona 9411 and the bearing surface was roughened and degreased. Belzona 1111 was mixed and applied, then the form was clamped in place. After a short cure, a new bearing was installed and the air handler was placed back on-line. The application was carried out in accordance with Belzona Know-How System Leaflet MPT-2.

Belzona Facts

The bearing seized after business hours the night before. The maintenance staff knew about Belzona's emergency shaft repair so

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
FS 695214
ISO 14001:2015
EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com


BELZONA
Repair • Protect • Improve

they called the local Belzona Distributor/Consultant for a repair the next morning.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

| | |
|----------------|---------------------------|
| ISO 9001:2015 | Belzona products are |
| FS 695214 | manufactured under an ISO |
| ISO 14001:2015 | 9000 Registered Quality |
| EMS 695213 | Management System. |

www.belzona.com

