

Belzona Delivers Critical Solution Using Rope Access

ID: 7915

Industry: Marine

Application:

Substrate: Steel


Products: * Belzona 1111 (Super Metal) Belzona 9341 ,

Customer Location: Water Taxi Service, Trinidad and Tobago

Application Date: 2018

Problem

The ferry had sustained a series of dents on its starboard side above the water line. One of the dents was perforated. The boat had recently come out of dry dock in preparation for certification and it was virtually impossible to send it back to dry dock given the cost and the tight timeline to commission it.

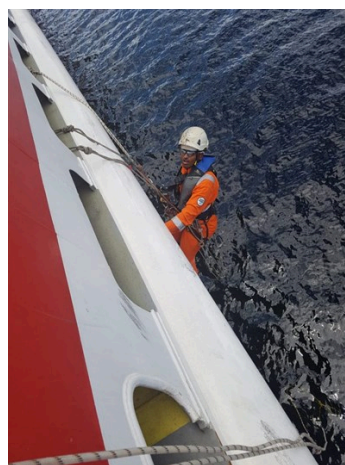

Photograph Descriptions

* Damaged areas on the starboard side of the ferry. Perforated dent area. A technician at work on a rope access. Complete application. ,

Application Situation

An interisland ferry that transports passengers between islands.

Application Method

The solution involved Rope Access to apply Belzona 1111 and Belzona 9341 to rebuild the dents and seal the perforation. The application was carried out in accordance with modified versions of Belzona Know-How System Leaflets SOS -1 and SOS -2. We accessed the repair area via a 4-man rope access team. Surface preparation was performed using an MBX. The customer had their Project Manager on site and the service provider had a NACE – 2 Inspector.

Belzona Facts

This repair was planned, executed and handed over within a few hours to the delight of the customer. Once again, Belzona

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015

FS 695214

ISO 14001:2015

EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com


BELZONA
Repair • Protect • Improve

Copyright © Belzona International Limited 2025

demonstrated the versatility of its solutions to this customer. The vessel was commissioned successfully on time and continues to make the Trinidad-Tobago run without issue.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015	Belzona products are
FS 695214	manufactured under an ISO
ISO 14001:2015	9000 Registered Quality
EMS 695213	Management System.

www.belzona.com

