

Belzona Repairs and Protects a Concrete Clarifier



ID: 8017

Industry: Water / Wastewater
 Application: FPA-Floor Problem Areas
 Substrate: Concrete
 Products: Belzona 4911 (TX Conditioner),
 Belzona 4131 (Magma-Screed),

Customer Location: Scotland
 Application Date: April 2018

Problem

Replacing the concrete with more concrete would not solve the base issue. Shutdown time was also an issue on the repair. An abrasion-resistant system was required to put the clarifier back to service fast.

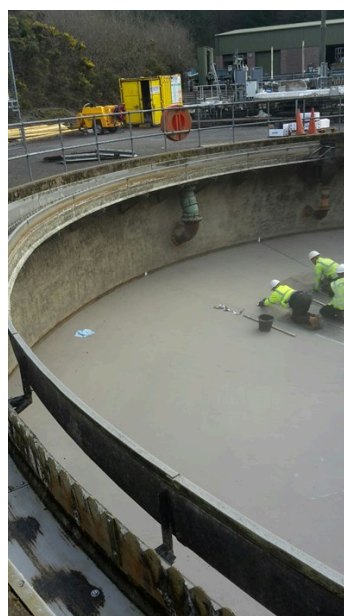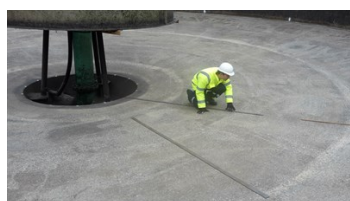

Placing screed rails

Belzona 4131 application by float

Application underway

The tank drained one year on

Application Situation

A concrete clarifier was suffering from erosion and chemical attack. The loose aggregate from the concrete was getting into the system pumps and the rough floor surface was causing wear issues on the rubber scrapers.

Application Method

The application was carried out in accordance with a modified version of Belzona KNow-How System Leaflet FPA-1. The concrete was first power washed and prepared mechanically. The clarifier was marked out into sections. Each section was then conditioned with Belzona 4911 and then 6mm of Belzona 4131 applied.

Belzona Facts

The project was completed in 8 days. A concrete pour would have taken at least 28 days to cure after the initial application. It would also suffer from similar chemical and abrasive attack. The Belzona system provided a fast turnaround system with superior

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
 FS 695214
 ISO 14001:2015
 EMS 695213

Belzona products are
 manufactured under an ISO
 9000 Registered Quality
 Management System.

www.belzona.com

BELZONA
 Repair • Protect • Improve

mechanical strength and chemical resistance the original concrete. The tank was drained for a shutdown in May 2019 & found to be in a perfect condition.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
FS 695214
ISO 14001:2015
EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com



Copyright © Belzona International Limited 2025