

Amine Regenerator Tower Receives Belzona Patch Repairs

ID: 8527

Industry: Chemical & Petrochemical
Application: TCC-Tanks and Chemical Containment Areas

Customer Location: United Kingdom


Application Date: May 2021

Substrate: Carbon Steel

Products: * Belzona 1511 (Super-HT Metal) ,
* Belzona 1593 ,

Problem

Due to heat treatment requirements weld repairs were not possible. A cold applied corrosion/erosion resistant solution was required.

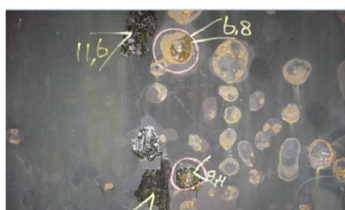

Photograph Descriptions

- * 1 - Metal loss picked up during inspection ,
- * 2 - Belzona 1593 applied ,
- * 3 - Close up of the coating ,

Application Situation

During a vessel inspection metal loss caused by corrosion was noted up to a maximum depth of 5mm.

Application Method

The area was grit blasted using chilled iron. Areas of metal loss were then rebuilt with Belzona 1511 HT Metal. Two coats of Belzona 1593 were then applied to the area.

Belzona Facts

The Belzona solution was applied in two days. It will provide long term protection for the vessel against the corrosive process conditions.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
FS 695214
ISO 14001:2015
EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com


BELZONA®
Repair • Protect • Improve