

Belzona Seals Leaking SF6 Flange


ID: 9521

Industry: Power
Application: VPF-Valves, Pipes and Fittings
Substrate: Aluminum
Products: Belzona 1981 (SuperWrap II), Belzona SuperWrap, Belzona 7311, Belzona 9111 (Cleaner Degreaser), Monti® MBX® Bristle Blaster®


Customer Location: London
Application Date: May 2024

Problem

The customer was suffering from the loss of SF6 gas from a horizontal pipe joint within a substation building. A solution was required to stop the loss of the gas to maintain a safe working system and save the custom from environmental fines. Previous successful repairs of different orientated pipework for the custom had been carried out nationwide, so the customer asked for the same solution to be applied to this leak.

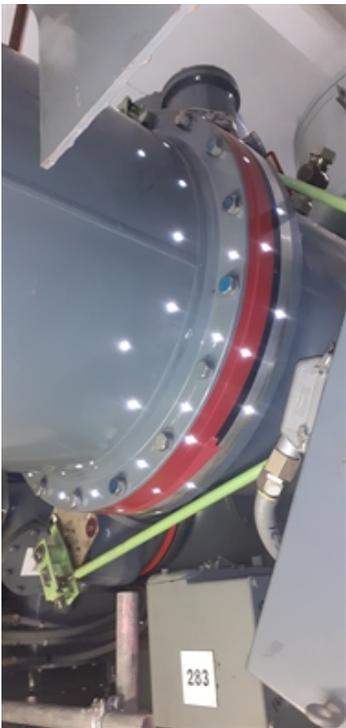

SF6 leaking from multiple location around pipe joint. Client covered joint with tape to stem leak.

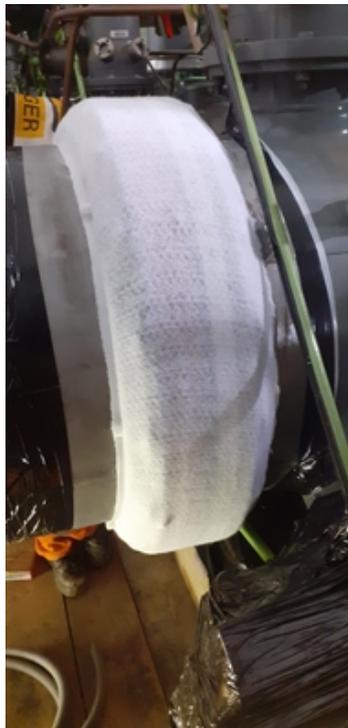

Repair area substrate prepared utilising bristle blaster and breather membrane installed.



Belzona 7311 applied to repair area incorporating Belzona 9341. 5x layers of Belzona 9371 using Belzona 1981 resin for wetting.



SF6-FIX leak sealing repair completed, with vent pipe left open at 6 o'clock position until full cure is achieved. Vent pipe is capped off following full cure.

Application Situation

Belzona's UK Distributor has carried out multiple repairs for the client who were very pleased with the results. As the repairs can be completed without disturbance to the power distribution process and save them further refilling costs the same solution was requested.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
FS 695214
ISO 14001:2015
EMS 695213

Belzona products are manufactured under an ISO 9000 Registered Quality Management System.

www.belzona.com

BELZONA
Repair • Protect • Improve

Application Method

The application area was prepared using MBX (Bristle Blaster). Stainless steel wheels were used as the substrate was aluminium. Substrate was degreased using Belzona 9111 to remove any contaminants.

Breather pipe and 3D printed base plate were installed at 6 o'clock position as SF6 is heavier than air.

Breather membrane was installed tightly to the profile of the flange due to restricted access from near-by components. Breather pipe was allowed to protrude through membrane.

A combination of Belzona 7311 and 9341 along with Belzona 1981 and Belzona 9371 were used to encapsulate the full circumference of the flange.

The breather pipe was left to vent until all materials used in the repair had achieved full cure. The vent pipe was then capped off and the system repressurised.

Belzona Facts

Belzona has been used to successfully repair multiple asset leaks for National grid making them cost savings by reducing their SF6 consumption, along with any associated environmental fines.

Numerous competitor repairs have been removed in favour of a Belzona solution due to failure and SF6 release.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015

Belzona products are

FS 695214

manufactured under an ISO

ISO 14001:2015

9000 Registered Quality

www.belzona.com

EMS 695213

Management System.

