

Belzona 4311 Renovates and Protects Sulfuric Containment for Future Use


ID: 9543

Industry: Power
Application: TCC-Tanks and Chemical Containment Areas
Substrate: Concrete
Products: Belzona 4111 (Magma-Quartz), Belzona 4311 (Magma CR1), Belzona 5811 (Immersion Grade)

Customer Location: Wilsonville, AL
Application Date: September 2024

Problem

Our client's containment was facing corrosion from sulfuric acid and needed a new coating to protect the concrete secondary containment. The existing coating was buckling and there were hollow pockets underneath.

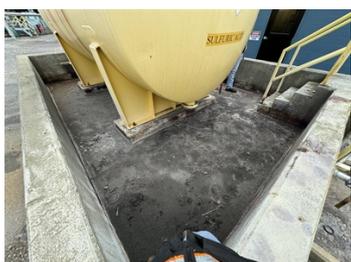

Before. Existing coating appeared not terrible but could easily be chipped away to reveal hollow concrete underneath.

Belzona 4111 was used to build a cove around the containment and pedestals on which the tank sits. We also used on heavily damaged areas.

Belzona 5811 was selected as the primer coat.

2 coats of Belzona 4311 to finish.

Application Situation

Our customer had used Belzona on other containments at the plant and this allowed an opportunity for another use. They needed a solid chemical barrier for possible acid leaks.

Application Method

The containment was first pressure washed which removed the hollow floor coating and 8" up the wall, we then followed with sand blasting where needed. Belzona 4111 was applied to the most damaged areas on the floor and walls. We also used it to build a 45 degree angle cove where the floor met the walls. Belzona 5811 was selected as the primer. We then followed with two coats of Belzona 4311.

Belzona Facts

Our customer has used Belzona before in other areas of the plant and needed a coating for this containment. we conducted our annual lunch and learn and this brought this new opportunity.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
FS 695214
ISO 14001:2015
EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com

**BELZONA**
Repair • Protect • Improve