

# Transformer bushing leak sealed with Belzona

ID: 4682


Industry: Power  
Application: MPT-Mechanical Power Transmission

Customer Location: Glasgow, Scotland  
Application Date: September 2013

Substrate: Steel  
Products: \* Belzona 9611 (ES-Metal) ,  
\* Belzona 1161 (Super UW-Metal) ,  
\* Belzona 5831 (ST-Barrier) ,

## Problem

The leaks were causing an environmental hazard as well as the inconvenience of having to top up the oil in the transformers every couple weeks. There was no way of sealing these leaks, welding was not an option due to the environment.

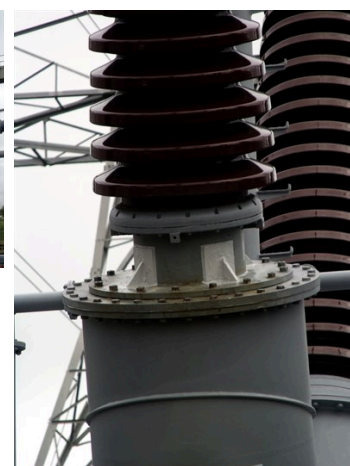

## Photograph Descriptions

- \* 1. Bushing before. ,
- \* 2. Struts before application showing crack. ,
- \* 3. Transformer after overcoating with Belzona 5831 ,
- \* 4. Plate bond after overcoating with Belzona 5831 ,

## Application Situation

Two 19 inch diameter bushings on a transformer were leaking oil. The leaks were coming from cracks in four steel support struts.

## Application Method

The repair was carried out in accordance with an adapted version of Belzona system Leaflet SOS\_1. The leaks were first stemmed using Belzona 9611. Pre blasted plates were then bonded into place around the struts using Belzona 1161, the purpose of these plates was to give the structure back some strength so the cracks in the steel would not propagate. The repairs were then protected with Belzona 5831.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015  
FS 695214  
ISO 14001:2015  
EMS 695213

Belzona products are  
manufactured under an ISO  
9000 Registered Quality  
Management System.

[www.belzona.com](http://www.belzona.com)

  
**BELZONA**  
Repair • Protect • Improve

Belzona Facts

Replacement of the busing would have taken weeks and cost tens of thousands of pounds. The application was carried out from an access tower over the course of two days so the saving to the client was in time, money & convenience

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015  
FS 695214  
ISO 14001:2015  
EMS 695213

Belzona products are  
manufactured under an ISO  
9000 Registered Quality  
Management System.

[www.belzona.com](http://www.belzona.com)

