

# BOW THRUSTER TUNNEL PROTECTED

ID: 5600



Industry: *Marine*  
Application: *SOS-Ships and Offshore Structures*

Customer Location: *Pacific Northwest*  
Application Date: *April 2015*

Substrate: *Carbon steel*  
Products: *\* Belzona 1311 (Ceramic R-Metal) ,*  
*\* Belzona 1321 (Ceramic S-Metal) ,*

## Problem

*Thruster tunnel was pitted and eroded in areas near thruster propulsion unit. Bi-metallic corrosion was also a component of the deterioration.*

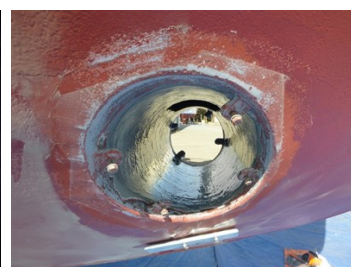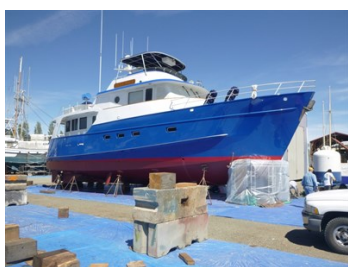

## Photograph Descriptions

- \* Vessel out of water with hutch built around thruster tunnel for containment. ,
- \* Tunnel prepared with abrasive blast. Note significant pitting on upper surfaces. ,
- \* Belzona 1311 applied to pitted areas as seen from inside vessel. ,
- \* Two coat application of Belzona 1321. Bottom paint will be lapped over Belzona 1321 at tunnel edge. ,

## Application Situation

Vessel in shipyard required resurfacing of bow thruster tunnel before launch. The owner was unaware of the problem prior to the vessel being hauled. Timely response was in order.

## Application Method

Tunnel was prepared by first removing several layers of bottom paint and then abrasive blasting to achieve a 3 mil profile. Belzona 1311 was applied to fill the pitting and erosion prior to the application of 2 coats of Belzona 1321.

## Belzona Facts

Vessel owner sought options to cutting out and replacing pitted bow thruster tunnel in private steel yacht. Prior experience in use of Belzona with his dredging company had convinced him Belzona materials were the right option.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015  
FS 695214  
ISO 14001:2015  
EMS 695213

Belzona products are  
manufactured under an ISO  
9000 Registered Quality  
Management System.

[www.belzona.com](http://www.belzona.com)

  
**BELZONA**  
Repair • Protect • Improve

---

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015  
FS 695214  
ISO 14001:2015  
EMS 695213

Belzona products are  
manufactured under an ISO  
9000 Registered Quality  
Management System.

[www.belzona.com](http://www.belzona.com)

*Copyright © Belzona International Limited 2025*

