

Belzona Renews Black Water Tank

ID: 595


Industry: *Marine*
Application: *SOS-Ships and Offshore Structures*

Customer Location: *Fort Lauderdale, Florida*
Application Date: *July 2005*

Substrate: *Marine aluminum*
Products: ** Belzona® 1121 (Super XL-Metal) ,*
** Belzona® 5811 (Immersion Grade) ,*

Problem

Severe pitting caused by H2S attack of aluminum walls, top and supports causing leakage of sewage to bilge.

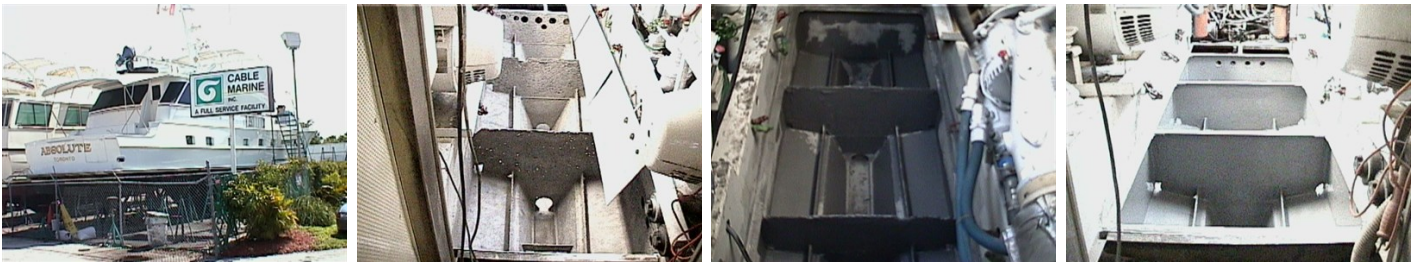

Photograph Descriptions

- * My Absolute at Cable Marine, Ft. Lauderdale, Florida ,
- * Severe pitting wastage of tank walls and supports ,
- * Doubler plates and Belzona® 1121 applied ,
- * Final protection with Belzona® 5811 awaiting top ,

Application Situation

Black water tank in 80 ft Aluminum motor yacht.

Application Method

Application was carried out in accordance with Belzona Know-How System Leaflet SOS-5. Doubler plates bonded to 4 sides and supports faired with Belzona® 1121. All surfaces coated with Belzona® 5811.

Belzona Facts

36kgs of Belzona® 1121 8 liters of Belzona® 5811 and three work days restored and protected tank from future attack. Welding would have taken weeks and coating would still have been needed.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
FS 695214
ISO 14001:2015
EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com

**BELZONA**
Repair • Protect • Improve