

# Belzona SuperWrap II used for a pipe repair

ID: 8332

Industry: Chemical & Petrochemical

Application: VPF-Valves, Pipes and Fittings

Substrate: Steel


Products: \* Belzona 1111 (Super metal) ,  
\* Belzona 9381 (SuperWrap II reinforcement sheet) ,  
\* Belzona 1982 (SuperWrap II) ,  
\* Belzona 9382 (Release film) ,

Customer Location: Petrochemical company, Slovakia

Application Date: 2020

## Problem

Underground pipe had developed thin-wall defect.

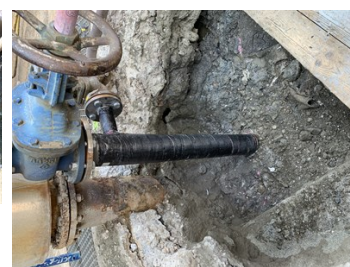

## Photograph Descriptions

\* 1.Underground pipe had developed thin-wall defect 2.The surface was blasted to the 75 microns profile and cleanliness Sa 2,5. 3. All system then was wrapped to Belzona 9382 4. Super Wrap II ready for use ,

## Application Situation

The customer recorded water leakage in system. Underground pipe had developed thin-wall defect. They tried to weld this damaged place several times. On the thin wall they found permanently new damages (also like thermal influence from welding)

## Application Method

The application was completed in accordance with Belzona System Leaflet VPF-11. The surface was blasted to the 75 microns profile and cleanliness Sa 2,5. Then the surface was chemically cleaned. To ensure a good profile (after plates welding) and damage repairs was Belzona 1111 used. Then Belzona 1982 and 9381 were applied in 2 layers. The system was then wrapped to Belzona 9382 to consolidate and compress during cure. Upper layer of the Belzona 9382 was removed after sufficient curing time.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015  
FS 695214  
ISO 14001:2015  
EMS 695213

Belzona products are  
manufactured under an ISO  
9000 Registered Quality  
Management System.

[www.belzona.com](http://www.belzona.com)

  
**BELZONA**<sup>®</sup>  
Repair • Protect • Improve

## Belzona Facts

The customer was not able to receive the good pipe repair by conventional welding, because several multiply plates welding constantly caused new and another pipes damages. Super Wrap II was very excellent, quick and long term solution.

---

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015  
FS 695214  
ISO 14001:2015  
EMS 695213

Belzona products are  
manufactured under an ISO  
9000 Registered Quality  
Management System.

[www.belzona.com](http://www.belzona.com)

