

# Belzona solution repairs Olympic Swimming Pool

ID: 8552

## Industry:

Application: GSS-Gaskets, Seals and Shims

Substrate: Metal


Products: \* Belzona 1111 (Super Metal) ,  
\* Belzona 9111 (Degreaser) ,  
\* Belzona 2911 (Elastomer QD Conditioner) ,  
\* Belzona 2211 (MP Hi-Build Elastomer) ,

Customer Location: Tunisia

Application Date: April 2007

## Problem

Corrosion beneath gaskets caused a damage to sealing faces

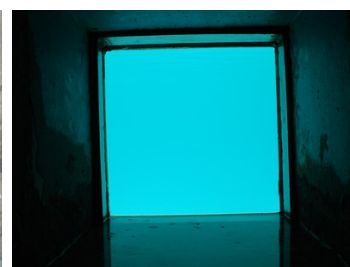

## Photograph Descriptions

- \* 1 : Olympic Swimming Pool ,
- \* 2 : Under water window severely damaged ,
- \* 3 : Fixation ,
- \* 4 : Camera under water ,

## Application Situation

Leakage of the under water window used for cameras

## Application Method

The application was carried out in accordance with Belzona Leaflets GSS-2. the area was prepared by rough grinding as well as the pre-formed seal, cleaned by Belzona 9111. Then the cold repair with Belzona 1111. Belzona conditioner 2911 was applied to both prepared surfaces. Application of Belzona 2211 and seal fixation.

## Belzona Facts

Low cost, fast et durable repair (still in good condition)

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015

FS 695214

ISO 14001:2015

EMS 695213

Belzona products are  
manufactured under an ISO  
9000 Registered Quality  
Management System.

[www.belzona.com](http://www.belzona.com)

  
**BELZONA**  
Repair • Protect • Improve