

Belzona Stops Live Leak

ID: 8937

Industry: *Pulp & Paper*
Application: *TCC-Tanks and Chemical Containment Areas*
Substrate: *Carbon steel*
Products: *Belzona 1212, Belzona 9611 (ES-Metal)*


Customer Location: *Central BC*
Application Date: *2019*

Problem

Leak developed in dissolving tank due to corrosion because of liner failure.



Leak as found

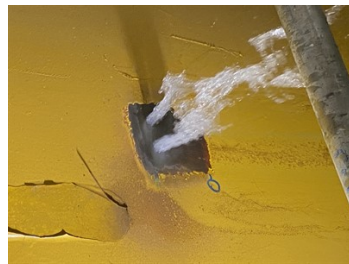

Surface Preparation completed with MBX



Leak stopped with Belzona 9611



Area reinforced with Belzona 1212/9341 Mesh

Application Situation

Live leak situation and area of mill could not be shut down. The customer needed an effective and quick solution. Shut down would have cost time and money

Application Method

Area prepped with bristle blaster and leak stopped with Belzona 9611. The repair was then consolidated with Belzona 1212 and the 9341 reinforcement mesh for higher pressure retention and a more long term repair.

Belzona Facts

Completing a live leak repair allowed our client to keep running and not stop the process. Saving valuable time and money. The Belzona 9611/1212 system allowed the leak to be sealed live and fast. Belzona 1212 was beneficial as it cured fully in a matter of hours, needed minimal surface preparation, and was tolerant to wet substrate at time of application.

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015
FS 695214
ISO 14001:2015
EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com


BELZONA
Repair • Protect • Improve