Heavily eroded heat exchanger components are revitalised

ID: 9797

Industry: Oil & Gas

Application: **HEX-Heat Exchangers**

Substrate: Carbon steel

Products: Belzona 1391T, Belzona 1511 (Super HT-Metal)

Problem


Four components from various vessels required internal repairs and coating to restore them to the required specification.



components were in need of repair



Heavily eroded heat exchanger Components are grit blasted back to expose eroded areas and produce a minimum surface profile

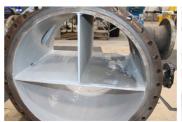

Customer Location: United Kingdom

Application Date: February 2025

After the components are reprofiled using Belzona 1511, the first coat of Belzona 1391T protected against erosion and is applied



Two coats of Belzona 1391T and the components are ready to go back into commission

Application Situation

Each component was in a heavy state of erosion suspected from chemical attack. After surface preparation, the components were reprofiled with Belzona 1511, then coated with Belzona 1391T to protect the components from future chemical attack.

Application Method

Substrate preparation was carried out with conventional grit blasting with an angular abrasive to achieve a minimum surface profile of 75µm and a surface cleanliness of SA 2½.

Following surface preparation, technicians applied Belzona 1511 to areas requiring reprofiling, restoring the internal body to an acceptable condition.

Where the internal diameter of nozzles were under 75mm, premanufactured nozzle inserts were installed. A two-coat system of Belzona 1391T was applied, with each coat achieving a target thickness of 450μm.

Belzona Facts

Belzona 1391T was chosen for the repairs due to its proven success on other process vessels at their site over the years.

For more examples of Belzona Know - How In Action, please visit https://khia.belzona.com

ISO 9001:2015 Belzona products are FS 695214 manufactured under an ISO ISO 14001:2015 9000 Registered Quality EMS 695213 Management System.

www.helzona.com