

Belt repair training at major distribution centre

ID: 9948

Industry: General Industry

Customer Location: Derbyshire

Application: SHM-Solids Handling Machinery


Application Date: July 2022

Substrate: Rubber

Products: Belzona 2911 (Elastomer QD Conditioner)

Problem



Numerous rips and tears were occurring at a huge distribution center, meaning costs were ever increasing on the replacement and downtime of conveyor belts

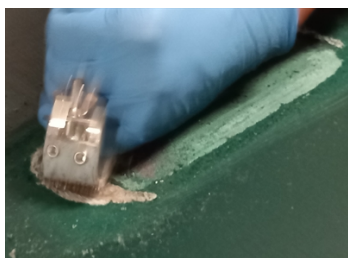

Area for demonstration identified, cut back and now being abraded



Area taped off and wetted out, Belzona 2311 applied following

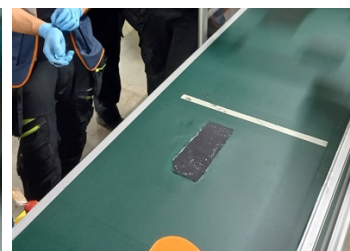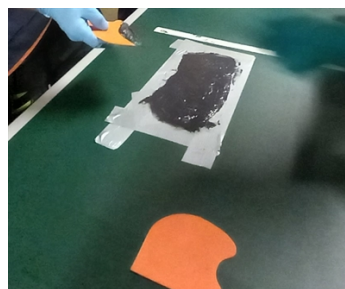

Repair and training completed

Application Situation

The training delivered by Belzona gave the engineering department full confidence in repairing their own conveyor belts, creating huge savings throughout the company

Application Method

The area was identified and all loose and stray pieces of belt were removed

The area was abraded using a Belzona Roughing brush and the taped with masking tape

Belzona 2911 conditioner was used to prepare the area, using a Large Working Surface under the repair area to protect the belt bed

The area was wetted out with Belzona 2311, prior to the Belzona 9341 reinforcing sheet, also wetted out with Belzona 2311

The area was built up with the remaining Belzona 2311 and smoothed with a Belzona applicator

The masking tape was removed and the repair left to cure

Belzona Facts

By training the engineers on site to carry out this work, the repairs offer substantial savings against the replacement of the belts

For more examples of Belzona Know - How In Action, please visit <https://khia.belzona.com>

ISO 9001:2015

FS 695214

ISO 14001:2015

EMS 695213

Belzona products are
manufactured under an ISO
9000 Registered Quality
Management System.

www.belzona.com


BELZONA
Repair • Protect • Improve